


Controller, Cables, Programmer and Hardware

MKIV RII 80 AMP.

Effective 12/19/03, MK5 NX-80 replaced MKIV RII as standard electronics on 400 Lb. limit chairs and PTO seating system chairs.

Effective 4/1/04, MK5 NX-80 replaced MKIV RII as standard electronics on 300 Lb. limit chairs.

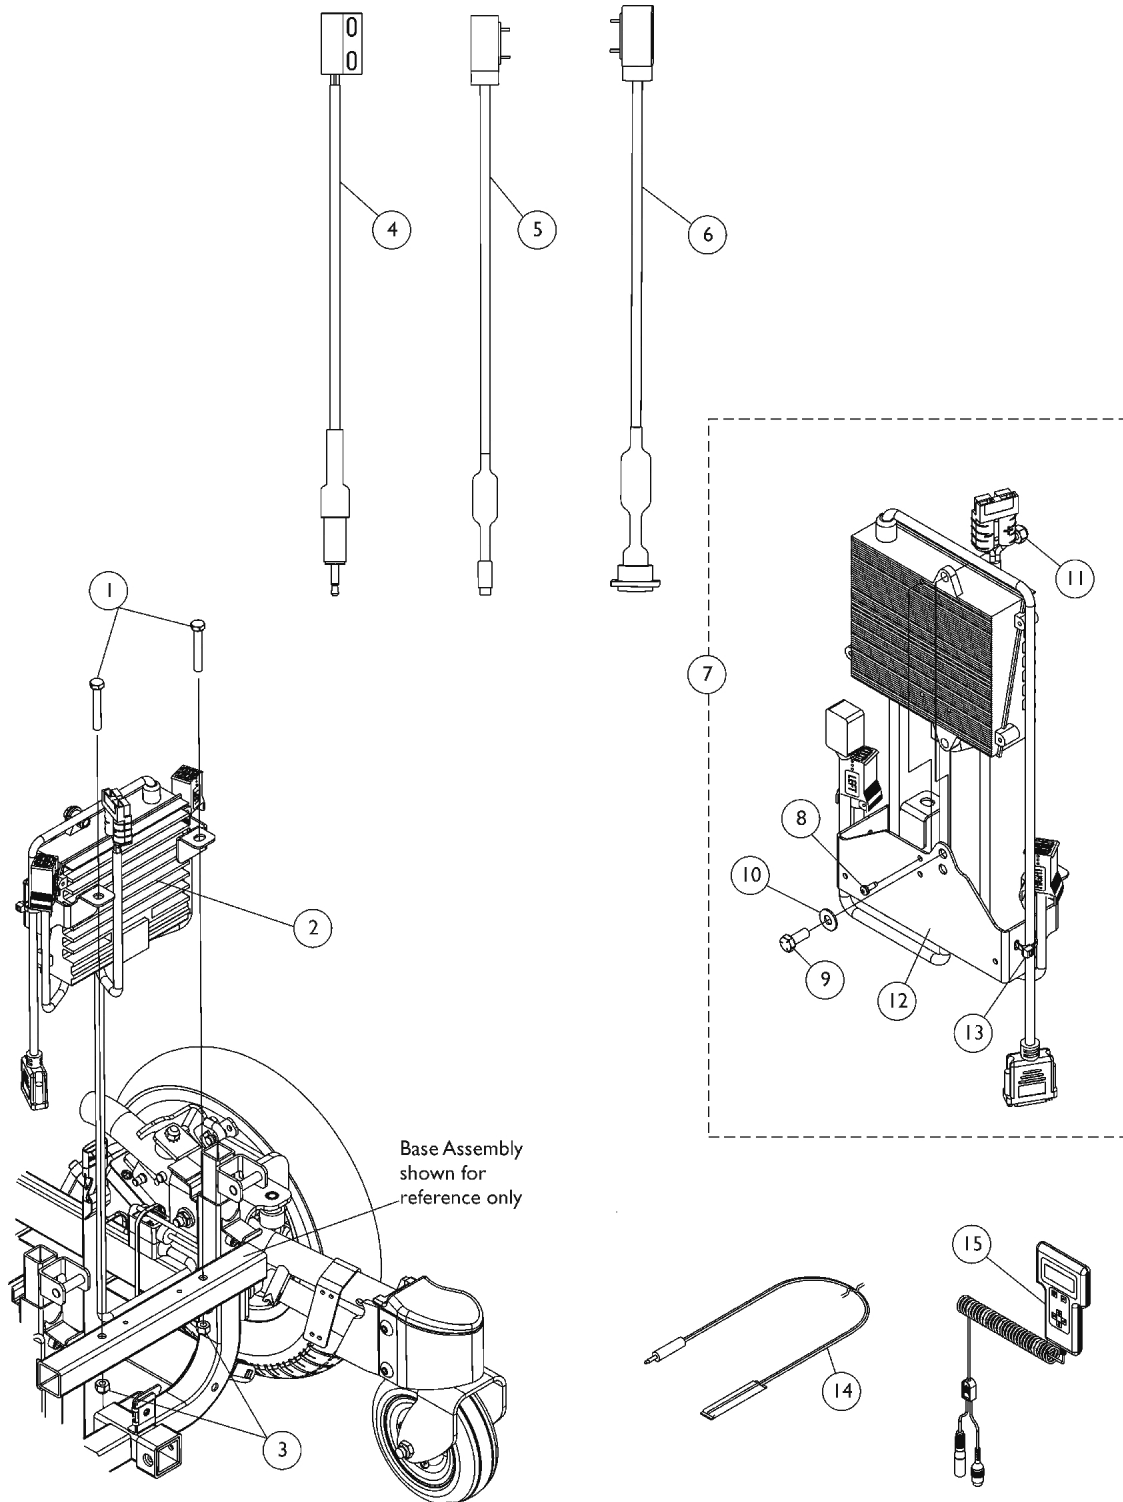

Controller, Cables, Programmer and Hardware

MKIV RII 80 AMP.

Effective 12/19/03, MK5 NX-80 replaced MKIV RII as standard electronics on 400 Lb. limit chairs and PTO seating system chairs.

Effective 4/1/04, MK5 NX-80 replaced MKIV RII as standard electronics on 300 Lb. limit chairs.

Item Number	Note	Part Number	Description	Quantity Per	
				Package	Assembly
1		1044939-NLA	NLA - Screw, Hex Head (5/16-18 x 1-3/4")	1	2
2		1106819-NLA	NLA - Controller, MKIV RII (80 AMP)	1	1
3		1026158	Locknut (5/16-18)	1	2
4		1074983-NLA	NLA - Cable, Limit Switch Sensor	1	1
5		1094872	Cable Option with Phono Jack	1	1
6		1114500-NLA	NLA - Cable Option with Charger Connector	1	1
7	A,G	1112783-NLA	NLA - Bracket with Hardware, Controller, M91/M94	1	1
8			NLA - Screw (#8-32 x 1/2")	1	1
9			NLA - Screw, Hex Head (5/16-18 x 3/4")	1	1
10			Washer, Steel (5/16 x 3/4 x 1/16")	1	1
11			Locknut (5/16-18)	1	1
12			NLA - Bracket, Controller Mounting, Black	1	1
13			Tie Wrap (11-1/2" L)	1	1
13		1095502-NLA	NLA - Package, Tie Wrap (11-1/2" L)	10	1
14	E	1020818	Switch, Red Flex Ribbon (Tape) Reset	1	1
14	F	1123276	Kit, Switch, Black Egg Reset w/ Hook/Loop Adhesive Back Fastener & Attaching Screws (EGSBLK)	1	1
15		1109091-NLA	NLA - Programmer, Remote	1	1
	B,C	1064404-NLA	NLA - Virtual Service Modem Kit	1	1
	B,D	1091631-NLA	NLA - Virtual Service Software Kit	1	1
	B,C	1103051-NLA	NLA - MKIV One 2 One Software Kit	1	1
	B	1095204-NLA	NLA - Cable, Virtual Service, Charger/Modem	1	1
	B	1091980-NLA	NLA - Disk, 3.5 H.D. Floppy with V.S. Software	1	1
	B	1091637-NLA	NLA - Adaptor, Null Modem	1	1
	B	1091636-NLA	NLA - Service Manual - V.S. Software Kit	1	1

NOTE: A - Includes items 8-13
 B - Not Shown
 C - Part number 1095204 is not available for individual sale
 D - Part numbers 1095204, 1091980, 1091637 and 1091636 are available for individual sale
 E - Before 5/24/04
 F - Not Shown. After 5/23/04 the Egg Reset Switch replaced the Red Flex Ribbon (Tape) Reset Switch
 G - Part number 1110665 item #12 is no longer available for individual sale. Order item #7 as a replacement.